

SANDY WICKENS MEMORIAL ARENA

SHORT TERM

- More consistent, accessibility signage required, colour-contrasted, tactile, braille, international symbol of access – washrooms, exits, etc. - Done
- Should be color contrast strip at the beginning and end of ramp. – outside.
- Parking lot curbing in area of ramp should be straightened out as it is a tripping hazard at the moment. - Done
- More signage required to identify entrance.
- Main Entrances should have color contrasting door frame.
- Stair risers and Steps need to be different color.
- Slip resistant strips required on bleacher stairs and 2 sets of stairs going to balcony. Music room stairs are ok (installed on inside platform ramp as well . - Done
- Tactile attention indicators required at top of stairs one tread depth from the edge of the stair. (24-26 inches in length)
- 4 accessible parking lots required. Currently there is 1 spot.
- black mat flooring has ½ inch lip creating tripping hazard when transitioning to cement floor. - Done
- floor has glare in some areas.
- Some obstructions along hallways and pathways (garbage cans, etc.). - Done
- Rope off area at the back of the arena (near Zamboni area) for staff use only. There are a lot of tripping hazards in this area. Should be for staff only.
- Some glare from lights block exit sign / along with ceiling pipes, etc. – No issues found
- Many exit signs are difficult to see and some were partially covered depending on where you stood. – No issues found

MEDIUM TERM

- Ramp handrails require some work – loose at one end and rough from rust. Requires repainting
- Ramp – Is the running slope less than 1:12 (8.33%) steep ?
- Ramp – Is the cross slope of the ramp less than 1:50 (2%) steep ?
- Entrance needs work – cement is crumbling – tripping hazard
- Railings should be contrasting color

- Railings should be brought down to the floor around seating area.
- Toilet paper dispensers are a bit high – Should be between 24 – 31 in.

LONG TERM

- Suggested textured/colored walkway to entrance
- Stair riser height and tread depths do not meet requirements.
- Doors leading to ice surface from lobby are not accessible
- Fire alarm system should include flashing lights for hearing impaired.